


Defect No.	Location on Structure	Condition Survey Inspection			
		Defect Description	Photo No.	Photograph of Defect	Proposed Repair Type
1	Throughout	Cracking to concrete deck slab. Worst case noted to be 50mm wide and full deck width.	IMG_202406_26_092214.jpg		No. 1
2	Throughout	Missing stones to substructure on North/South elevations.	IMG_202406_26_092451.jpg		No. 2
3	CH: 2.5m	Missing concrete deck slab and void area within substructure.	IMG_202406_26_091808.jpg		No. 3
4	CH: 51-55m	Missing and loose concrete deck slab. Void area within substructure below missing deck slab.	IMG_202406_26_092932.jpg		No. 4
5	CH:55m	Missing and loose concrete end wall.	IMG_202406_26_092702.jpg		No. 4

DEFECT SCHEDULE

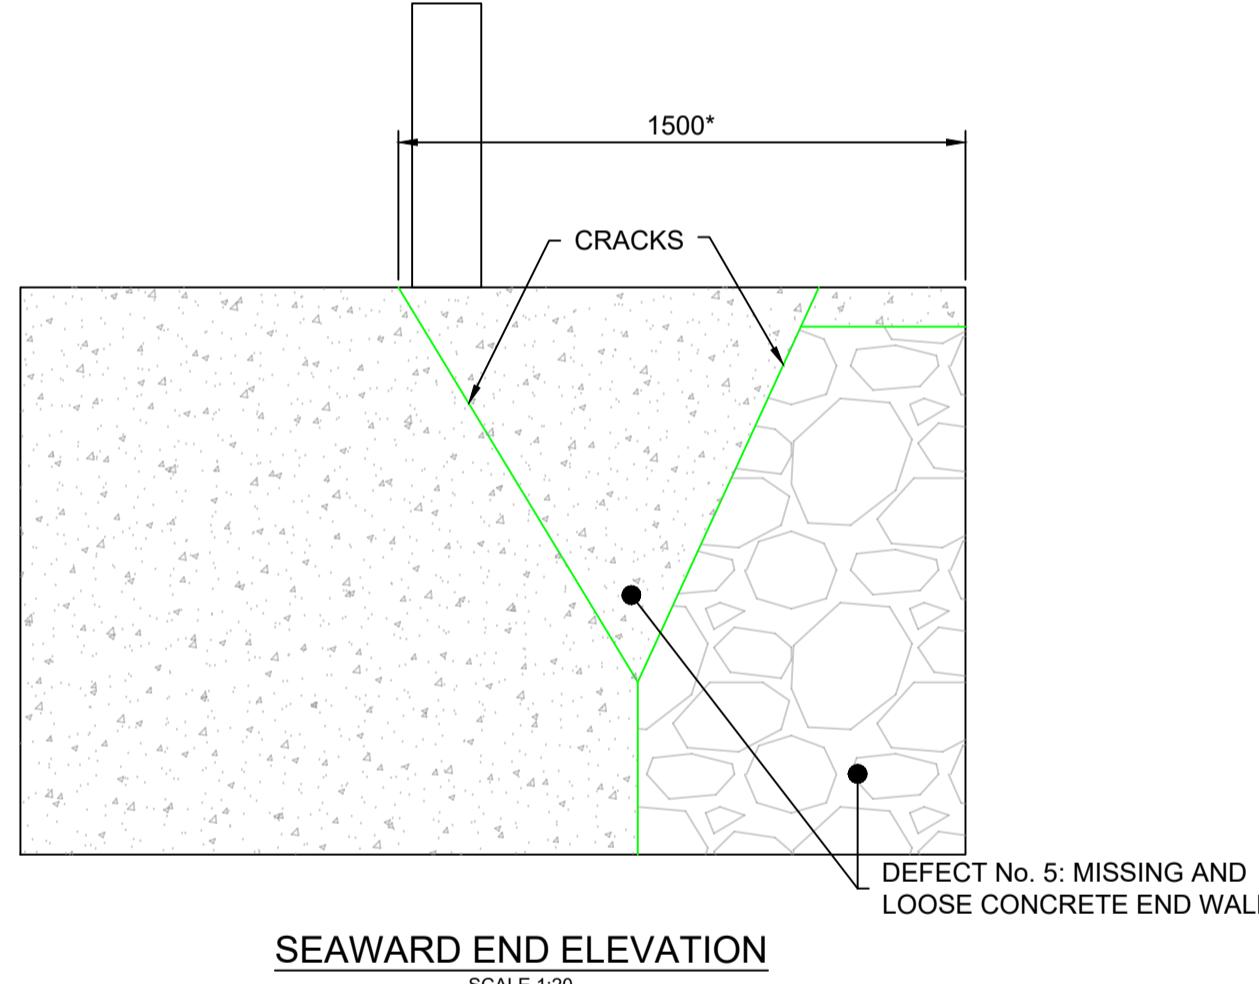

COLOUR CODE

BLACK	- EXISTING OR UNCHANGED
BLUE	- MODIFIED / OR REINSTATED
GREEN	- DEFECTS
RED	- NEW, PROPOSED OR ADDITIONAL

P02	27/08/24	DRAFT	BZ	CS
P01	16/08/24	DRAFT FOR COMMENT	KD	CS
Rev	Date	Description of Revisions	Drawn	Chkd

Status

DRAFT

Client(s)



MHB Consultants Ltd
3rd Floor
52 St Enoch Sq
Glasgow G1 4AA
0141 248 5154
info@mhbconsultants.com
www.mhbconsultants.com

ROCKCLIFFE JETTY

EXISTING LAYOUT AND DEFECTS

Scale(s) AS SHOWN	Drawn	Date 08/09/2024	Checked	Date 27/08/2024	Approved	Date
Drawing Number 3756-MHB-DRG-100	P02					

Legend/Notes
GENERAL NOTES

- ALL DIMENSIONS IN MILLIMETRES UNLESS OTHERWISE STATED
- ALL SHOWN DIMENSIONS ARE INDICATIVELY BASED UPON RECORDINGS AS NO TOPOGRAPHICAL SURVEY HAS BEEN UNDERTAKEN / PROVIDED
- ALL SIZES ARE INDICATIVE BASED UPON SITE FINDINGS. CONTRACTOR TO CONFIRM PRIOR TO WORKS COMMENCING.
- THIS DRAWING SHALL BE READ IN CONJUNCTION WITH 3756-MHB-DRG-001 GENERAL NOTES AND ALL DRAWINGS LISTED THEREIN
- TYPICAL HAZARDS THAT SHOULD BE IDENTIFIED BY A COMPETENT CONTRACTOR ARE NOT INCLUDED. THE CONTRACTOR SHALL CARRY OUT THE WORKS USING AN APPROPRIATE SAFE SYSTEM OF WORK. FURTHER INFORMATION OF HAZARDS CAN BE FOUND IN THE DESIGNERS RISK ASSESSMENT 3756-MHB-DRA-001.
- THE CONTRACTOR TO ENSURE THAT MEASURES ARE TAKEN TO PREVENT POLLUTION OF WATER WITH SUSPENDED SOLIDS, FUELS, OR OTHER HARMFUL SUBSTANCES.
- ALL DEFECTS REFERENCED ARE DETAILED WITH DEFECT SCHEDULE 3756-MHB-REP-001